


Single head system



Dimensions

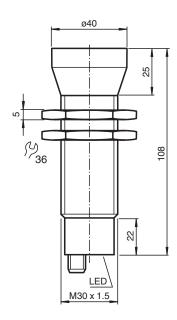

Technical Data		
General specifications		
Sensing range	200 4000 mm	
Adjustment range	240 4000 mm	
Dead band	0 200 mm	
Standard target plate	100 mm x 100 mm	
Transducer frequency	approx. 85 kHz	
Response delay	approx. 325 ms	
Indicators/operating means		
LED green	solid: Power-on flashing: program function object detected	

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

Pepperl+Fuchs Group www.pepperl-fuchs.com USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com



UB4000-30GM-E5-V15

Technical Data		
LED yellow		solid: switching state switch output flashing: program function
LED red		normal operation: "fault" program function: no object detected
Electrical specifications		
Operating voltage	U _B	10 30 V DC , ripple 10 % _{SS}
No-load supply current	I ₀	≤ 50 mA
Input/Output		
Synchronization		bi-directional 0 level -U _B +1 V 1 level: +4 V+U _B input impedance: > 12 KOhm synchronization pulse: ≥ 100 μ s, synchronization interpulse period: ≥ 2 ms
Synchronization frequency		
Common mode operation		max. 13 Hz
Multiplex operation		\leq 13 Hz / n , n = number of sensors , n \leq 5
Innut		
Input		1 program input
Input type		1 program input, operating range 1: $-U_B \dots + 1 V$, operating range 2: $+4 V \dots + U_B$ input impedance: $> 4.7 k\Omega$; program pulse: $\ge 1 s$
Output		
Output type		1 switch output PNP, Normally open/closed, programmable
Rated operating current	l _e	200 mA , short-circuit/overload protected
Voltage drop	U_d	≤ 2.5 V
Repeat accuracy		\leq 0.5 % of switching point
Switching frequency	f	≤ 1.5 Hz
Range hysteresis	Н	1 % of the set operating distance
Temperature influence		< 2 % of far switch point
Compliance with standards and directives		
Standard conformity		
Standards		EN 60947-5-2:2007+A1:2012 IEC 60947-5-2:2007 + A1:2012
Approvals and certificates		
EAC conformity		TR CU 020/2011 TR CU 037/2016
UL approval		cULus Listed, General Purpose
CSA approval		cCSAus Listed, General Purpose
CCC approval		CCC approval / marking not required for products rated \leq 36 V
Ambient conditions		
Ambient temperature		-25 70 °C (-13 158 °F)
Storage temperature		-40 85 °C (-40 185 °F)
Mechanical specifications		
Connection type		Connector plug M12 x 1 , 5-pin
Degree of protection		IP65
Material		
Housing		nickel plated brass; plastic components: PBT
Transducer		epoxy resin/hollow glass sphere mixture; polyurethane foam
Mass		180 g
Factory settings		
Output		Switch point A1: 550 mm Switch point A2: 4200 mm output function: Window mode output behavior: NO contact

Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

Connection

Standard symbol/Connections: (version E5, pnp)

(version ES, prip)				
		1	(BN)	+ U _R
		2	(WH)	Program input
U		5	(GY)	Sync. input
		4	(BK)	Switch output
		3	(BU)	
			•	- O _B

Wire colors in accordance with EN 60947-5-2.

Connection Assignment




Wire colors in accordance with EN 60947-5-2

1	BN	(brown)
2	WH	(white)
3	BU	(blue)
4	BK	(black)
5	GY	(gray)

Characteristic Curve

Characteristic response curve

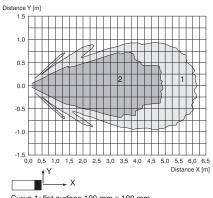


Curve 1: flat surface 100 mm x 100 mm Curve 2: round bar, Ø 25 mm

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

3

Programming

Programmable output modes

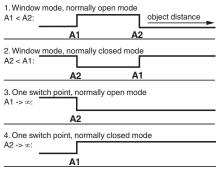


5. A1 ->∞, A2 ->∞: Object presence detection mode Object detected: Switch output closed No object detected: Switch output open

Accessories

	BF 30	Mounting flange, 30 mm
1000 1000 1000	BF 5-30	Universal mounting bracket for cylindrical sensors with a diameter of 5 30 mm
	UB-PROG2	Programming unit
Q.	UVW90-M30	Ultrasonic -deflector
	UVW90-K30	Ultrasonic -deflector
00	M30K-VE	Plastic nuts with centering ring for the vibration-free mounting of cylindrical sensors
	V15-G-2M-PVC	Female cordset single-ended M12 straight A-coded, 5-pin, PVC cable grey

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"



4

Programming

Programming procedure

The sensor features a programmable switch output with two programmable switch points. Programming the switch points and the operating mode is done by applying the supply voltage $-U_B$ or $+U_B$ to the Teach-In input. The supply voltage must be applied to the Teach-In input for at least 1 s. LEDs indicate whether the sensor has recognized the target during the programming procedure.

Note:

If a programming adapter UB-PROG2 is used for the programming procedure, button A1 is assigned to -U_B and button A2 is assigned to +U_B.

Programming of the switch output

Window Modes

Normally open (NO) output

- 1. Place the target at the near end of the desired switch window
- 2. Program the window boundary by applying -U_B to the Teach-In input (yellow and green LEDs flash)
- 3. Disconnect the Teach-In input from -U_B to save the window boundary
- 4. Place the target at the far end of the desired switch window
- 5. Program the window boundary by applying +U_B to the Teach-In input (yellow and green LEDs flash)
- 6. Disconnect the Teach-In input from +U_B to save the window boundary

Normally closed (NC) output

- 1. Place the target at the near end of the desired switch window
- 2. Program the window boundary by applying +U_B to the Teach-In input (yellow and green LEDs flash)
- 3. Disconnect the Teach-In input from $+U_B$ to save the window boundary
- 4. Place the target at the far end of the desired switch window
- 5. Program the window boundary by applying -U_B to the Teach-In input (yellow and green LEDs flash)
- 6. Disconnect the Teach-In input from -U_B to save the window boundary

Switch Point Modes

Normally open (NO) output

- 1. Place the target at the desired switch point position
- 2. Program the switch point by applying +UB to the Teach-In input (yellow and green LEDs flash)
- 3. Disconnect the Teach-In input from +U_B to save the switch point
- 4. Cover the sensor face with hand or remove all objects from sensing range
- 5. Program the switch point by applying -U_B to the Teach-In input (red and yellow LEDs flash)
- 6. Disconnect the Teach-In input from -U_B to save the switch point

Normally closed (NC) output

- 1. Place the target at the desired switch point position
- 2. Program the switch point by applying -U_B to the Teach-In input (yellow and green LEDs flash)
- 3. Disconnect the Teach-In input from -U_B to save the switch point
- 4. Cover the sensor face with hand or remove all objects from sensing range
- 5. Program the switch point by applying +UB to the Teach-In input (red and yellow LEDs flash)
- 6. Disconnect the Teach-In input from +U_B to save the switch point

Object Detection Mode

- 1. Cover the sensor face with hand or remove all objects from sensing range
- 2. Apply -U_B to the Teach-In input (red and yellow LEDs flash)
- 3. Disconnect the Teach-In input from +U_B to save the setting
- 4. Apply $+U_B$ to the Teach-In input (red and yellow LEDs flash)
- 5. Disconnect the Teach-In input from $+U_B$ to save the setting

Factory Setting

Factory settings

See technical data.

Indication

The sensor provides LEDs to indicate various conditions.

	green LED	red LED	yellow LED
During normal			
operation			
Proper operation	On	Off	Switching state
Interference	Off	Flashing	Previous state
(e.g. compressed air)			

Refer to "General Notes Relating to Pepperl+Fuchs Product Information

During sensor			
programming			
Object detected	Flashing	Off	Flashing
No object detected	Off	Flashing	Flashing
Object uncertain	Off	Flashing	Flashing
(programming invalid)		-	-

Commissioning

Synchronization

This sensor features a synchronization input for suppressing ultrasonic mutual interference ("cross talk"). If this input is not connected, the sensor will operate using internally generated clock pulses. It can be synchronized by applying an external square wave. The pulse duration must be \geq 100 µs. Each falling edge of the synchronization pulse triggers transmission of a single ultrasonic pulse. If the synchronization signal remains low for \geq 1 second, the sensor will revert to normal operating mode. Normal operating mode can also be activated by opening the signal connection to the synchronization input (see note below).

If the synchronization input goes to a high level for > 1 second, the sensor will switch to standby mode, indicated by the green LED. In this mode, the outputs will remain in the last valid output state.

Note:

If the option for synchronization is not used, the synchronization input has to be connected to ground (0 V) or the sensor must be operated via a V1 cordset (4-pin).

The synchronization function cannot be activated during programming mode and vice versa.

The following synchronization modes are possible:

- 1. Several sensors (max. number see technical data) can be synchronized together by interconnecting their respective synchronization inputs. In this case, each sensor alternately transmits ultrasonic pulses in a self multiplexing mode. No two sensors will transmit pulses at the same time (see note below).
- 2. Multiple sensors can be controlled by the same external synchronization signal. In this mode the sensors are triggered in parallel and are synchronized by a common external synchronization pulse.
- 3. A separate synchronization pulse can be sent to each individual sensor. In this mode the sensors operate in external multiplex mode (see note below).
- 4. A high level $(+U_B)$ on the synchronization input switches the sensor to standby mode.

Note:

Sensor response times will increase proportionally to the number of sensors that are in the synchronization string. This is a result of the multiplexing of the ultrasonic transmit and receive signal and the resulting increase in the measurement cycle time.

Installation Conditions

If the sensor is installed in an environment where the temperature can fall below 0 °C, one of these mounting flanges must be used for mounting: BF30, BF30-F, or BF 5-30.

If it is intended to operate the sensor at - 25 °C, we recommend discussing the mounting situation with a Pepperl + Fuchs application specialist to ensure a trouble-free operation.

If the sensor is mounted in a through hole using the included steel nuts, it must be mounted at the middle of the threaded housing. If it must be mounted at the front end of the threaded housing, plastic nuts with centering ring (optional accessories) must be used.

6